


FIBERLINE

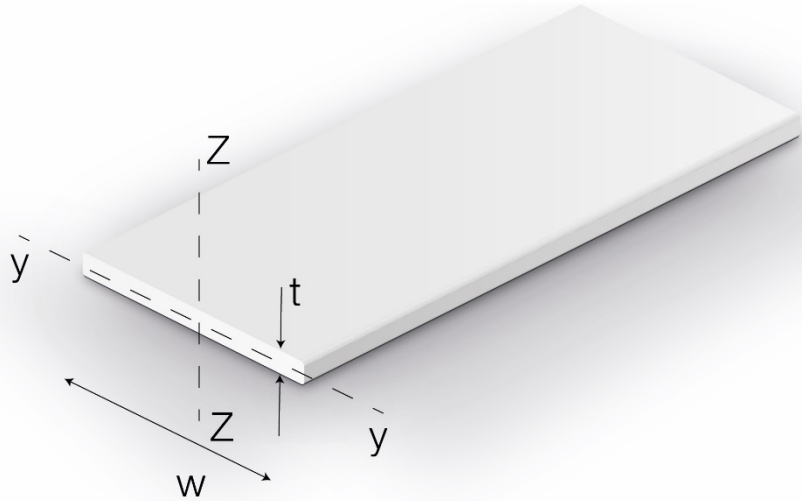

Flat profiles

Flat profile w x t	w mm	t mm	A mm ²	As,z mm ²	As,y mm ²	g kg/m	I _{yy} mm ⁴	I _{zz} mm ⁴
Factor	1	1	10 ³	10 ³	10 ³	1	10 ⁶	10 ⁶
30 x 6	30	6	0,18	0,12	0,12	0,32	0,0005	0,013
50 x 6	50	6	0,3	0,20	0,20	0,54	0,0009	0,062
100 x 6	100	6	0,6	0,40	0,40	1,08	0,0018	0,500
100 x 8	100	8	0,8	0,53	0,53	1,44	0,0043	0,670
100 x 10	100	10	1,0	0,67	0,67	1,80	0,0083	0,833
500 x 6	500	6	3,0	2,00	2,00	5,40	0,009	62,5
500 x 10	500	10	5,0	3,32	3,32	9,00	0,0417	104,180